

Appliance Service Record

Date: Friday, 15 May, 2020

Cert. No: RP-1151359-1522708001



Gas-elec Group
Summer Road,
Walsham - Le -
Willows,
Bury St Edmunds,
IP31 3AJ



Client:

Site Add:

APPLIANCE

Location/Position	Type	Type of Boiler	Make	Model	Flue Type	Serial No.	Gas Council Number	Approx. age
Kitchen Compartment	Boiler/Combi	Combi Boiler	Vaillant	ecoTec pro28 VUW GB	Room Sealed	21133200 100116901 30	47-044-45	6

APPLIANCE CHECKLIST	Result	Rectification work necessary / completed
Stability	Pass	
Controls	Pass	
Electrics	Pass	
Pipework	Pass	
Location	Pass	
Gaskets/Seals	Pass	Replaced burner door seal.
Gas Connections	Pass	
Burner/Injectors	Pass	Cleaned
Leaks Gas/Water	Pass	
Casing	Pass	
Ignition	Pass	
Heat Exchanger	Pass	
Fan Assembly	Pass	
Flame Picture	N/A	
Return air (warm air only)	N/A	
Fireplace/Catchment	N/A	
Overflow/Discharge	Pass	Condensate waste pump fitted.
Closure Plate	N/A	
Appliance water flow rate and temperature	Pass	
Additional checks completed		

SAFETY TESTS	Faults found and rectification work	
Safety Device satisfactory?	Yes	
Ventilation satisfactory?	Yes	
Flue flow test satisfactory?	N/A	
Spillage test satisfactory?	N/A	
Flue termination satisfactory?	Yes	
Visual check satisfactory?	Yes	
Tightness test satisfactory?	Yes	
Operating pressure / gas rate satisfactory?	Yes	
Operating pressure / gas rate reading	26.00 kW (NETT)	
Installation safe to use?	Yes	
Appliance safe to use?	Yes	

FGA (Flue Gas Analysis) READINGS	
CO (PPM):	64
CO2 (%):	9.1
CO/CO2 Ratio:	0.0007

Engineer Comments
The condensate waste pipe is preventing the removal of the condensate sump for cleaning.
The central heating timer selector switch on the boiler is missing/broken off.

In the event of a complaint relating to any service or installation in a property gas-elec must be given the opportunity to address the issue by re-visiting the property to resolve any alleged complaint. gas-elec cannot be held responsible if the opportunity to fully address the matter is not afforded to us. In the event of another company/contractor being called to the property to investigate or attempt to rectify an alleged complaint in preference to gas-elec the company will accept no liability. A detailed internal inspection of the flue integrity, construction and lining has not been carried out. I confirm that the situation(s) recorded above, has been identified and brought to the attention of the Responsible Person in accordance with the GSIUR, and Gas Industry Unsafe Situations Procedure. This report has been completed and issued by Gas-elec Safety (UK) Ltd.

Engineer name:
Engineer signature:

This report has been produced in accordance with the Gas-Elec Group working method statement which covers COVID -19 virus procedures.
A copy of this working method statement can be found on: www.gas-elec.co.uk/cvd19

Accompanying Photos



Gas-elec Group
 Summer Road,
 Walsham - Le - Willows,
 Bury St Edmunds,
 IP31 3AJ 7PJ
 TEL : 0800 5879999

Job No.: 1522708

Date : 15/05/2020



Accompanying photos provided by the engineer

Description: CH timer plastic selector switch missing.



Description: Cooker hood filter panel missing.



SAMPLE

gas-elec

group

The results shown on this report reflect the situation at the time of the inspection. Gas-Elec, its employees and engineers cannot be held responsible for any failure of the boiler or heating system after the inspection.

The report is a general visual, surface and functional examination of the central heating and / or plumbing system without risk of causing damage to the property or injury to the inspector. Due care is therefore exercised throughout the inspection regarding safety, practically and the constraints of being a visitor to the property (which may be occupied). Furniture, floor coverings and the contents are not moved or lifted and no part is forced or laid open to make accessible. Gas-elec Safety (UK) Ltd. or it's employees accept no liability for the consequences of any errors or omissions on this report.

Inspector:

Inspector Signature: